
## PL-PN1-4M

## **Internal Electrical Wiring Diagram**

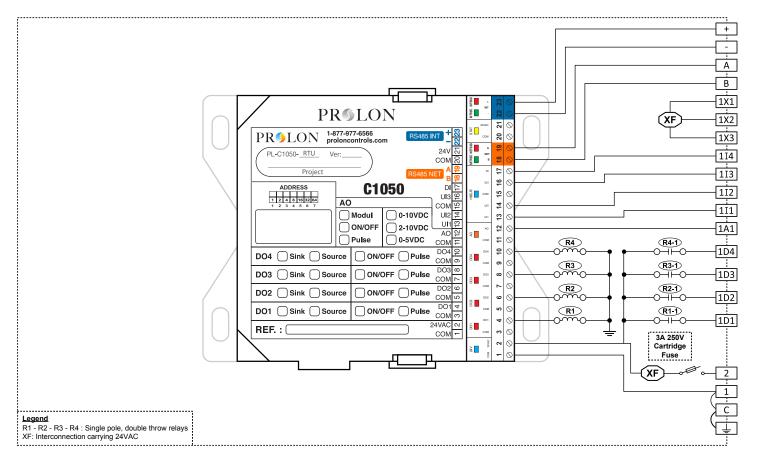

## **Field Wiring Details**

ALL TERMINALS: Use Copper Conductors Only, 105°C/220°F, Maximum Torque Conductor Mounting: 0.5Nm

Terminal	Function	Ratings
Ţ	GROUND	N/A
1	Power Supply Input Common	N/A
2	Power Supply Input 24VAC	24VAC, 3A, 60Hz
1D1	R1 - Output 1 - Fan (G)	24VAC, 300mA
1D2	R2 - Output 2 - Cooling (Y1)	24VAC, 300mA
1D3	R3 - Output 3 - Cooling (Y2)	24VAC, 300mA
1D4	R4 - Output 4 - Heat (W1)	24VAC, 300mA
1A1	Output 5 (Analog 0-10VDC) - Preheating / Heat (W2)	0-10VDC, 40mA
111	Outside Air Temperature Sensor (10K Thermistor)	N/A
112	Return Air Temperature Sensor (10K Thermistor)	N/A
113	Supply Temperature Sensor (10K Thermistor)	N/A

Terminal	Function	Ratings
114	External Dry Contact for Night Setback or Proof of Fan	N/A
1X3	Power Supply 24VAC	24VAC, 3A, 60Hz
1X2	Power Supply 24VAC	24VAC, 3A, 60Hz
1X1	Power Supply 24VAC	24VAC, 3A, 60Hz
+	C1050 RS485 INT A (+)	N/A
-	C1050 RS485 INT B (-)	N/A
Α	C1050 RS485 NET A (+)	N/A
В	C1050 RS485 NET B (-)	N/A
С	COMMON	N/A
XF	24VAC Supply	24VAC