
## PL-PN2-1A-7N / PL-PN2-1B-7N

## **Internal Electrical Wiring Diagram**

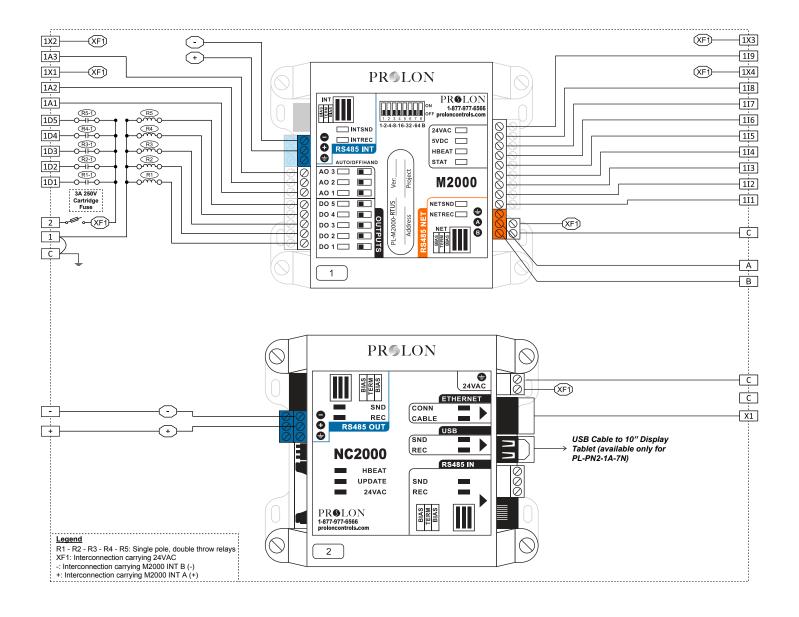

## **Field Wiring Details**

<u>ALL TERMINALS</u>: Use Copper Conductors Only, 105°C/220°F, Maximum Torque Conductor Mounting: 0.5Nm

Terminal	Function	Ratings
Ť	GROUND	N/A
1	Power Supply Input Common	N/A
2	Power Supply Input 24VAC	24VAC, 3A, 60Hz
1D1	R1 - Fan Output (G)	24VAC, 300mA
1D2	R2 - Cooling Output 1 (Y1)	24VAC, 300mA
1D3	R3 - Cooling Output 2 (Y2)	24VAC, 300mA
1D4	R4 - Heating Output 1 (W1)	24VAC, 300mA
1D5	R5 - Heating Output 2 (W2) or Exhaust Fan	24VAC, 300mA
1A1	Modulating Heating Output	0-10VDC, 40mA
1A2	Economizer Control Output	0-10VDC, 40mA
1X1	Economizer Supply	24VAC, 8.5VA
1A3	Bypass or VFD Control Output	0-10VDC, 40mA
1X2	Bypass or VFD Supply	24VAC, 5VA
1X3	Static Pressure Sensor Supply	24VAC, 0.03A
119	Static Pressure Sensor Input Signal	0-5VDC, 5uA

Terminal	Function	Ratings
1X4	CO2 Sensor Supply	24VAC, 6.7VA
118	CO2 Sensor Input Signal	4-20mA, 1-5VDC
117	Dry Contact for Proof of Fan	N/A
116	Zone Setpoint Potentiometer (0-9K)	N/A
115	Zone Temperature Thermistor (10K Type 3)	N/A
114	Variable Function Temprature Sensor	N/A
1I3	Supply Air Temperature Thermistor (10K Type 3)	N/A
1I2	Return Air Temperature Thermistor (10K Type 3)	N/A
1I1	Outside Air Temperature Thermistor (10K Type 3)	N/A
+	NC2000 / M2000 RS485 INT A (+)	N/A
-	NC2000 / M2000 RS485 INT B (-)	N/A
А	M2000 RS485 NET A (+)	N/A
В	M2000 RS485 NET B (-)	N/A
X1	NC2000 Ethernet Connection (Use CAT5e Patch Cable)	N/A
С	COMMON	N/A